



MANDELL ENVIRONMENTAL CONSULTING

409 MINNISINK ROAD • SUITE 102 • TOTOWA, NJ 07512 • (973) 785-7574 • FAX (973) 785-0561

Limited Water Sampling Report

Project Name: The Leaguers Head Start
Project Location: 1111 Chandler Avenue, Roselle, NJ
Date of Sampling: October 28, 2023 & November 9, 2023

Limited water sampling was performed by Mandell Environmental Consulting at The Leaguers Head Start, 1111 Chandler Avenue, Roselle, NJ. Water samples were collected from the kitchen sink faucet, water fountain, and water coolers used by the child care center. Samples were also collected from 50% of the other indoor water faucets utilized by the child care. The samples were collected prior to water being used in the building for a minimum of 8 hours and not longer than 48 hours. The samples were collected in 250 milliliter (ml) containers accordance with New Jersey Regulations

The samples collected were submitted for analysis to Pace Analytical, 575 Broad Hollow Road, Melville, NY 11747, certification # NY158. Samples were analyzed by Graphite Furnace AA, EPA 200.9. The following table contains the results of the sampling. The maximum contaminant level (MCL) for lead in drinking water is 15 ug/L and copper 1,300 ug/L. (Laboratory Results and sampling forms Attached).

Sample Date 10/28/2023


Sample Number	Source	Results Lead	Results Copper	Units	Pos/Neg
L-1	Water Fountain 1	<1.0	1350	ug/L	Pos.
L-2	Outlet 1	<1.0	535	ug/L	Neg.
L-3	Outlet 4	<1.0	414	ug/L	Neg.
L-4	Outlet 6	<1.0	529	ug/L	Neg.
L-5	Outlet 8	<1.0	616	ug/L	Neg.
L-6	Outlet 10	<1.0	686	ug/L	Neg.
L-7	Outlet 12	<1.0	345	ug/L	Neg.
L-8	Outlet 14	2.1	1380	ug/L	Pos.
L-9	Outlet 15	2.8	379	ug/L	Neg.
L-10	Portable Sink	<1.0	46.5	ug/L	Neg.
L-11	Water Cooler 1	<1.0	<2.0	ug/L	Neg.
L-12	Water Cooler 2	<1.0	<2.0	ug/L	Neg.

Sample Date 11/09/2023

Sample Number	Source	Results Lead	Results Copper	Units	Pos/Neg
1111-1A	Outlet 14	<1.0	35.9	ug/L	Neg.

The laboratory results show that two of the samples were found to exceed the copper in drinking water action level of 1,300 ug/L. The samples were collected from the water fountain and outlet 14. The water fountain has been taken out of service. The follow up flush sample result of outlet 14 did not exceed copper in drinking water action level of 1,300 ug/L Sampling forms and diagram are attached.

Sampling Performed by: **Stuart Casciano**
 NJ Lead Inspector/Risk Assessor
 Mandell Environmental Consulting
 409 Minnisink Road, Suite 102
 Totowa, NJ 07512

Signed:  Date: 11-30-2023



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

November 02, 2023

Stuart Casciano
Mandell Environmental Consulting
409 Minnisink Road
Suite 102
Totowa, NJ 07512

RE: Project: THE LEAGUERS 10/30
Pace Project No.: 70275883

Dear Stuart Casciano:

Enclosed are the analytical results for sample(s) received by the laboratory on October 31, 2023. The results relate only to the samples included in this report. Results reported herein conform to the applicable TNI/NELAC Standards and the laboratory's Quality Manual, where applicable, unless otherwise noted in the body of the report.

The test results provided in this final report were generated by each of the following laboratories within the Pace Network:

- Pace Analytical Services - Melville

If you have any questions concerning this report, please feel free to contact me.

Sincerely,

Kimberley M. Mack
kimberley.mack@pacelabs.com
516-370-6052
Project Manager

Enclosures



REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

CERTIFICATIONS

Project: THE LEAGUERS 10/30
Pace Project No.: 70275883

Pace Analytical Services Long Island

575 Broad Hollow Rd, Melville, NY 11747
Connecticut Certification #: PH-0435
Delaware Certification # NY 10478
Maryland Certification #: 208
Massachusetts Certification #: M-NY026
New Hampshire Certification #: 2987

New Jersey Certification #: NY158
New York Certification #: 10478 Primary Accrediting Body
Pennsylvania Certification #: 68-00350
Rhode Island Certification #: LAO00340
Virginia Certification # 460302

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

ANALYTICAL RESULTS

Project: THE LEAGUERS 10/30

Pace Project No.: 70275883

Sample: L-1 WATER FOUNTAIN		Lab ID: 70275883001		Collected: 10/28/23 10:15		Received: 10/31/23 08:00		Matrix: Drinking Water	
Parameters		Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual
200.8 MET ICPMS Drinking Water		Analytical Method: EPA 200.8 Pace Analytical Services - Melville							
Copper	1350	ug/L	10.0	5		11/01/23 16:25	7440-50-8		
Lead	<1.0	ug/L	1.0	1		11/01/23 15:30	7439-92-1		

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.

Date: 11/02/2023 12:09 PM

Page 3 of 21



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

ANALYTICAL RESULTS

Project: THE LEAGUERS 10/30

Pace Project No.: 70275883

Sample: L-2 OUTLET 1		Lab ID: 70275883002		Collected: 10/28/23 10:16		Received: 10/31/23 08:00		Matrix: Drinking Water	
Parameters		Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual
200.8 MET ICPMS Drinking Water		Analytical Method: EPA 200.8 Pace Analytical Services - Melville							
Copper	535	ug/L	2.0	1		11/01/23 15:32	7440-50-8		
Lead	<1.0	ug/L	1.0	1		11/01/23 15:32	7439-92-1		

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.

Date: 11/02/2023 12:09 PM

Page 4 of 21



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

ANALYTICAL RESULTS

Project: THE LEAGUERS 10/30

Pace Project No.: 70275883

Sample: L-3 OUTLET 4		Lab ID: 70275883003	Collected: 10/28/23 10:18	Received: 10/31/23 08:00	Matrix: Drinking Water			
Parameters	Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual
200.8 MET ICPMS Drinking Water		Analytical Method: EPA 200.8 Pace Analytical Services - Melville						
Copper	414	ug/L	2.0	1		11/01/23 15:33	7440-50-8	
Lead	<1.0	ug/L	1.0	1		11/01/23 15:33	7439-92-1	

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

ANALYTICAL RESULTS

Project: THE LEAGUERS 10/30

Pace Project No.: 70275883

Sample: L-4 OUTLET 6		Lab ID: 70275883004		Collected: 10/28/23 10:19		Received: 10/31/23 08:00		Matrix: Drinking Water	
Parameters		Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual
200.8 MET ICPMS Drinking Water		Analytical Method: EPA 200.8 Pace Analytical Services - Melville							
Copper	529	ug/L	2.0	1		11/01/23 15:35	7440-50-8		
Lead	<1.0	ug/L	1.0	1		11/01/23 15:35	7439-92-1		

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.

Date: 11/02/2023 12:09 PM

Page 6 of 21



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

ANALYTICAL RESULTS

Project: THE LEAGUERS 10/30
Pace Project No.: 70275883

Sample: L-5 OUTLET 8		Lab ID: 70275883005		Collected: 10/28/23 10:21		Received: 10/31/23 08:00		Matrix: Drinking Water	
Parameters		Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual
200.8 MET ICPMS Drinking Water		Analytical Method: EPA 200.8 Pace Analytical Services - Melville							
Copper	616	ug/L	2.0	1		11/01/23 15:36	7440-50-8		
Lead	<1.0	ug/L	1.0	1		11/01/23 15:36	7439-92-1		

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

ANALYTICAL RESULTS

Project: THE LEAGUERS 10/30

Pace Project No.: 70275883

Sample: L-6 OUTLET 10		Lab ID: 70275883006		Collected: 10/28/23 10:23		Received: 10/31/23 08:00		Matrix: Drinking Water	
Parameters		Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual
200.8 MET ICPMS Drinking Water		Analytical Method: EPA 200.8 Pace Analytical Services - Melville							
Copper	686	ug/L	2.0	1		11/01/23 15:41	7440-50-8		
Lead	<1.0	ug/L	1.0	1		11/01/23 15:41	7439-92-1		

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.

Date: 11/02/2023 12:09 PM

Page 8 of 21



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

ANALYTICAL RESULTS

Project: THE LEAGUERS 10/30
Pace Project No.: 70275883

Sample: L-7 OUTLET 12		Lab ID: 70275883007	Collected: 10/28/23 10:25	Received: 10/31/23 08:00	Matrix: Drinking Water			
Parameters	Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual
200.8 MET ICPMS Drinking Water		Analytical Method: EPA 200.8 Pace Analytical Services - Melville						
Copper	345	ug/L	2.0	1		11/01/23 15:46	7440-50-8	M1
Lead	<1.0	ug/L	1.0	1		11/01/23 15:46	7439-92-1	

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

ANALYTICAL RESULTS

Project: THE LEAGUERS 10/30
Pace Project No.: 70275883

Sample: L-8 OUTLET 14		Lab ID: 70275883008		Collected: 10/28/23 10:27		Received: 10/31/23 08:00		Matrix: Drinking Water	
Parameters		Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual
200.8 MET ICPMS Drinking Water		Analytical Method: EPA 200.8 Pace Analytical Services - Melville							
Copper	1380	ug/L	4.0	2		11/01/23 16:26	7440-50-8	M1	
Lead	2.1	ug/L	1.0	1		11/01/23 15:50	7439-92-1		

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

ANALYTICAL RESULTS

Project: THE LEAGUERS 10/30

Pace Project No.: 70275883

Sample: L-9 OUTLET 15 Lab ID: 70275883009 Collected: 10/28/23 10:28 Received: 10/31/23 08:00 Matrix: Drinking Water

Parameters	Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual
200.8 MET ICPMS Drinking Water		Analytical Method: EPA 200.8 Pace Analytical Services - Melville						
Copper	379	ug/L	2.0	1		11/01/23 15:55	7440-50-8	
Lead	2.8	ug/L	1.0	1		11/01/23 15:55	7439-92-1	

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.

Date: 11/02/2023 12:09 PM

Page 11 of 21



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

ANALYTICAL RESULTS

Project: THE LEAGUERS 10/30

Pace Project No.: 70275883

Sample: L-10 PORTABLE SINK	Lab ID: 70275883010	Collected: 10/28/23 10:29	Received: 10/31/23 08:00	Matrix: Drinking Water				
Parameters	Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual

200.8 MET ICPMS Drinking Water

Analytical Method: EPA 200.8

Pace Analytical Services - Melville

Copper	46.5	ug/L	2.0	1		11/01/23 16:00	7440-50-8	
Lead	<1.0	ug/L	1.0	1		11/01/23 16:00	7439-92-1	

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.

Date: 11/02/2023 12:09 PM

Page 12 of 21



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

ANALYTICAL RESULTS

Project: THE LEAGUERS 10/30

Pace Project No.: 70275883

Sample: L-11 WATER COOLER 1		Lab ID: 70275883011		Collected: 10/28/23 10:32		Received: 10/31/23 08:00		Matrix: Drinking Water	
Parameters		Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual
200.8 MET ICPMS Drinking Water		Analytical Method: EPA 200.8 Pace Analytical Services - Melville							
Copper	<2.0	ug/L	2.0	1		11/01/23 16:01	7440-50-8		
Lead	<1.0	ug/L	1.0	1		11/01/23 16:01	7439-92-1		

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.

Date: 11/02/2023 12:09 PM

Page 13 of 21



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

ANALYTICAL RESULTS

Project: THE LEAGUERS 10/30
Pace Project No.: 70275883

Sample: L-12 WATER COOLER 2		Lab ID: 70275883012	Collected: 10/28/23 10:33	Received: 10/31/23 08:00	Matrix: Drinking Water			
Parameters	Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual
200.8 MET ICPMS Drinking Water		Analytical Method: EPA 200.8 Pace Analytical Services - Melville						
Copper	<2.0	ug/L	2.0	1		11/01/23 16:03	7440-50-8	
Lead	<1.0	ug/L	1.0	1		11/01/23 16:03	7439-92-1	

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.

Date: 11/02/2023 12:09 PM

Page 14 of 21



QUALITY CONTROL DATA

Project: THE LEAGUERS 10/30
Pace Project No.: 70275883

QC Batch: 325960 Analysis Method: EPA 200.8
QC Batch Method: EPA 200.8 Analysis Description: 200.8 MET No Prep Drinking Water
Laboratory: Pace Analytical Services - Melville
Associated Lab Samples: 70275883001, 70275883002, 70275883003, 70275883004, 70275883005, 70275883006

METHOD BLANK: 1665535 Matrix: Water
Associated Lab Samples: 70275883001, 70275883002, 70275883003, 70275883004, 70275883005, 70275883006

Parameter	Units	Blank Result	Reporting Limit	Analyzed	Qualifiers
Copper	ug/L	<2.0	2.0	11/01/23 14:53	
Lead	ug/L	<1.0	1.0	11/01/23 14:53	

LABORATORY CONTROL SAMPLE: 1665536

Parameter	Units	Spike Conc.	LCS Result	LCS % Rec	% Rec Limits	Qualifiers
Copper	ug/L	50	46.7	93	85-115	
Lead	ug/L	50	47.0	94	85-115	

MATRIX SPIKE SAMPLE: 1665538

Parameter	Units	70275820019 Result	Spike Conc.	MS Result	MS % Rec	% Rec Limits	Qualifiers
Copper	ug/L	0.50 mg/L	100	576	80	70-130	
Lead	ug/L	<2.0	100	95.1	95	70-130	

MATRIX SPIKE SAMPLE: 1665540

Parameter	Units	70275820020 Result	Spike Conc.	MS Result	MS % Rec	% Rec Limits	Qualifiers
Copper	ug/L	0.63 mg/L	100	677	46	70-130	M1
Lead	ug/L	<2.0	100	92.4	92	70-130	

SAMPLE DUPLICATE: 1665537

Parameter	Units	70275820019 Result	Dup Result	RPD	Qualifiers
Copper	ug/L	0.50 mg/L	506	2	
Lead	ug/L	<2.0	<2.0		

SAMPLE DUPLICATE: 1665539

Parameter	Units	70275820020 Result	Dup Result	RPD	Qualifiers
Copper	ug/L	0.63 mg/L	608	4	
Lead	ug/L	<2.0	<2.0		

Results presented on this page are in the units indicated by the "Units" column except where an alternate unit is presented to the right of the result.

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.



QUALITY CONTROL DATA

Project: THE LEAGUERS 10/30
Pace Project No.: 70275883

QC Batch: 325962 Analysis Method: EPA 200.8
QC Batch Method: EPA 200.8 Analysis Description: 200.8 MET No Prep Drinking Water
Laboratory: Pace Analytical Services - Melville
Associated Lab Samples: 70275883007, 70275883008, 70275883009, 70275883010, 70275883011, 70275883012

METHOD BLANK: 1665548 Matrix: Water
Associated Lab Samples: 70275883007, 70275883008, 70275883009, 70275883010, 70275883011, 70275883012

Parameter	Units	Blank Result	Reporting Limit	Analyzed	Qualifiers
Copper	ug/L	<2.0	2.0	11/01/23 15:42	
Lead	ug/L	<1.0	1.0	11/01/23 15:42	

LABORATORY CONTROL SAMPLE: 1665549

Parameter	Units	Spike Conc.	LCS Result	LCS % Rec	% Rec Limits	Qualifiers
Copper	ug/L	50	46.7	93	85-115	
Lead	ug/L	50	47.1	94	85-115	

MATRIX SPIKE SAMPLE: 1665551

Parameter	Units	70275883007 Result	Spike Conc.	MS Result	MS % Rec	% Rec Limits	Qualifiers
Copper	ug/L	345	50	368	46	70-130	M1
Lead	ug/L	<1.0	50	43.9	88	70-130	

MATRIX SPIKE SAMPLE: 1665553

Parameter	Units	70275883008 Result	Spike Conc.	MS Result	MS % Rec	% Rec Limits	Qualifiers
Copper	ug/L	1380	100	1350	-30	70-130	M1
Lead	ug/L	2.1	50	58.3	112	70-130	

SAMPLE DUPLICATE: 1665550

Parameter	Units	70275883007 Result	Dup Result	RPD	Qualifiers
Copper	ug/L	345	328	5	
Lead	ug/L	<1.0	<1.0		

SAMPLE DUPLICATE: 1665552

Parameter	Units	70275883008 Result	Dup Result	RPD	Qualifiers
Copper	ug/L	1380	1390	1	
Lead	ug/L	2.1	2.1	1	

Results presented on this page are in the units indicated by the "Units" column except where an alternate unit is presented to the right of the result.

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.



QUALIFIERS

Project: THE LEAGUERS 10/30

Pace Project No.: 70275883

DEFINITIONS

DF - Dilution Factor, if reported, represents the factor applied to the reported data due to dilution of the sample aliquot.

ND - Not Detected at or above adjusted reporting limit.

TNTC - Too Numerous To Count

J - Estimated concentration above the adjusted method detection limit and below the adjusted reporting limit.

MDL - Adjusted Method Detection Limit.

PQL - Practical Quantitation Limit.

RL - Reporting Limit - The lowest concentration value that meets project requirements for quantitative data with known precision and bias for a specific analyte in a specific matrix.

S - Surrogate

1,2-Diphenylhydrazine decomposes to and cannot be separated from Azobenzene using Method 8270. The result for each analyte is a combined concentration.

Consistent with EPA guidelines, unrounded data are displayed and have been used to calculate % recovery and RPD values.

LCS(D) - Laboratory Control Sample (Duplicate)

MS(D) - Matrix Spike (Duplicate)

DUP - Sample Duplicate

RPD - Relative Percent Difference

NC - Not Calculable.

SG - Silica Gel - Clean-Up

U - Indicates the compound was analyzed for, but not detected.

N-Nitrosodiphenylamine decomposes and cannot be separated from Diphenylamine using Method 8270. The result reported for each analyte is a combined concentration.

Reported results are not rounded until the final step prior to reporting. Therefore, calculated parameters that are typically reported as "Total" may vary slightly from the sum of the reported component parameters.

Pace Analytical is TNI accredited. Contact your Pace PM for the current list of accredited analytes.

TNI - The NELAC Institute.

ANALYTE QUALIFIERS

M1 Matrix spike recovery exceeded QC limits. Batch accepted based on laboratory control sample (LCS) recovery.

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.



QUALITY CONTROL DATA CROSS REFERENCE TABLE

Project: THE LEAGUERS 10/30
Pace Project No.: 70275883

Lab ID	Sample ID	QC Batch Method	QC Batch	Analytical Method	Analytical Batch
70275883001	L-1 WATER FOUNTAIN	EPA 200.8	325960		
70275883002	L-2 OUTLET 1	EPA 200.8	325960		
70275883003	L-3 OUTLET 4	EPA 200.8	325960		
70275883004	L-4 OUTLET 6	EPA 200.8	325960		
70275883005	L-5 OUTLET 8	EPA 200.8	325960		
70275883006	L-6 OUTLET 10	EPA 200.8	325960		
70275883007	L-7 OUTLET 12	EPA 200.8	325962		
70275883008	L-8 OUTLET 14	EPA 200.8	325962		
70275883009	L-9 OUTLET 15	EPA 200.8	325962		
70275883010	L-10 PORTABLE SINK	EPA 200.8	325962		
70275883011	L-11 WATER COOLER 1	EPA 200.8	325962		
70275883012	L-12 WATER COOLER 2	EPA 200.8	325962		

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.

CHAIN-OF-CUSTODY / Analytical Request Document

The Chain-of-Custody is a LEGAL DOCUMENT. All relevant fields must be completed accurately.

Section A: Required Client Information: Company: MANDELL ENVIRONMENTAL Address: 609 INDUSTRIAL ROAD Suite 102, TOWSON, MD 21204 Email To: MANDELL@ENVIRONMENTAL Phone: 410-733-1234 Fax: 410-733-1234 Requested Date of Delivery: 10/29/2023		Section B: Required Project Information: Report To: MANDELL ENV. Copy To: Purchase Order No.: Project Name: THE LEAGUERS Project Number: 1111 CHANDLER AVE Requested Analysis Filtered (Y/N): ROSELLE NJ		Section C: Invoice Information: Attention: Company Name: MANDELL ENV. Address: City/State: ROSELLE NJ Regulatory Agency: MDDES Ground Water: ☒ DRINKING WATER UST: ☐ RORA Other: ☐ Site Location: NJ State: NJ		Page: 1 of 1 2054211	
Section D: Required Client Information: Matrix Codes: DW: Drinking Water WW: Wastewater P: Potable Water SL: Soil OL: Oil WP: Wastewater AR: Air TS: Tissue OT: Other		SAMPLE ID (1-2, 0-3, 1-4) Sample IDs MUST BE UNIQUE		COLLECTED COMPOSITE START COMPOSITE END DATE TIME		SAMPLE TYPE (G-GRAB C-COMP) MATRIX CODE (see wild codes to left) DATE TIME	
PRESERVATIVES HCl HNO ₃ H ₂ SO ₄ NaOH Na ₂ S ₂ O ₈ Other		UNPRESERVED ANALYST'S TEST & RESULTS LEAD COPPER		# OF CONTAINERS SAMPLE TEMP AT COLLECTION DATE TIME		ACCEPTED BY / AFFILIATION DATE TIME	
ADDITIONAL COMMENTS L-1 WATER FOUNTAIN L-2 OUTLET 1 L-3 OUTLET 4 L-4 OUTLET 6 L-5 OUTLET 8 L-6 OUTLET 10 L-7 OUTLET 12 L-8 OUTLET 14 L-9 OUTLET 15 L-10 PORTABLE SINK L-11 WATER COOLER 1 L-12 WATER COOLER 2		RELINQUISHED BY / AFFILIATION DATE TIME		SAMPLE CONDITIONS Received on: 10/30/23 Temp in °C: 10.3 Ice (Y/N): N Sealed Cooler (Y/N): N Custody (Y/N): N Samples intact (Y/N): Y		SIGNATURE OF SAMPLER: SNAGT CHASANO DATE SIGNED: 10-29-2023 CHAIN-OF-CUSTODY: 10-29-2023	

WO#: 70275883

Client Name Mandell (MEL)

Project #

PM: KMH

Due Date: 11/07/23

Courier: ☒ Fed Ex ☐ UPS ☐ USPS ☐ Client ☐ Commercial ☒ Pace ☐ Other

CLIENT: MEC

Tracking #:

Custody Seal on Cooler/Box Present: ☐ Yes ☒ No Seals intact: ☐ Yes ☒ No Temperature Blank Present: ☐ Yes ☒ No
Packing Material: ☐ Bubble Wrap ☐ Bubble Bags ☒ Ziploc ☐ None ☐ Other Type of Ice: ☒ Wet ☐ Blue ☐ None

Thermometer Used: 71198 Correction Factor: -0.3 ☐ Samples on ice, cooling process has begun

Cooler Temperature (°C): 5.1 Cooler Temperature Corrected (°C): 4.8 Date/Time 5035A kits placed in freezer

Temp should be above freezing to 6.0°C

USDA Regulated Soil ☒ N/A water sample

Did samples originate in a quarantine zone within the United States: AL, AR, CA, FL, GA, ID, LA, MS, NC, NM, NY, OK, OR, SC, TN, TX,
or VA (check map)? ☐ Yes ☒ No

Did samples originate from a foreign source including Hawaii and Puerto Rico? ☐ Yes ☒ No

If Yes to either question, fill out a Regulated Soil Checklist (ENV-FRM-MELV-0076) and include with SCUR/COC paperwork.

Date and Initials of person examining contents: 18/10/23

	COMMENTS:
Chain of Custody Present: ☒ Yes ☐ No	1.
Chain of Custody Filled Out: ☒ Yes ☐ No	2.
Chain of Custody Relinquished: ☒ Yes ☐ No	3.
Sampler Name & Signature on COC: ☒ Yes ☐ No ☐ N/A	4.
Samples Arrived within Hold Time: ☒ Yes ☐ No	5.
Short Hold Time Analysis (<72hr): ☒ Yes ☐ No	6.
Rush Turn Around Time Requested ☒ Yes ☐ No	7.
Sufficient Volume: (Triple volume provided for MS/MSD) ☒ Yes ☐ No	8.
Correct Containers Used: ☒ Yes ☐ No	9.
Pace Containers Used: ☒ Yes ☐ No	10.
Containers Intact: ☒ Yes ☐ No	11.
Filtered volume received for Dissolved tests: ☒ Yes ☐ No ☐ N/A	Note: if sediment is visible in the dissolved container.
Sample Labels match COC: ☒ Yes ☐ No	12.
-Includes date/time ID/Analysis: Matrix: ☒ SL ☐ WT ☐ OIL ☐ OTHER	

Date and Initials of person checking preservation: 18

All containers needing preservation have been ☒ Yes ☐ No ☐ N/A	13. ☐ HNO ₃ ☐ H ₂ SO ₄ ☐ NaOH ☐ HCl
pH paper Lot # <u>22782W</u>	Sample #
All containers needing preservation are found to be in compliance with method recommendation? (HNO ₃ , H ₂ SO ₄ , HCl, NaOH > 9 Sulfide) ☒ Yes ☐ No ☐ N/A	
Exceptions: VOA, Coliform, TOC/DOC, Oil and Grease, DRO/8015 (water).	
Per Method, VOA pH is checked after analysis	Initial when completed: Let # of added preservatives: Date/Time preservative added:
Samples checked for dechlorination: ☐ Yes ☐ No ☐ N/A	14.
KI starch test strips Lot #	Positive for Res. Chlorine? Y N
Residual chlorine strips Lot #	15.
SM 4500 CN samples checked for sul ☒ Yes ☐ No ☐ N/A	Positive for Sulfide? Y N
Lead Acetate Strips Lot #	16.
Headspace in VOA Vials (>6mm): ☐ Yes ☐ No ☐ N/A	17.
Trip Blank Present: ☐ Yes ☐ No ☐ N/A	
Trip Blank Custody Seals Present ☐ Yes ☐ No ☐ N/A	

Client Notification/ Resolution:

Field Data Required? Y / N

Person Contacted:

Date/Time:

Comments/ Resolution:

PM (Project Manager) review is documented electronically in UMS.



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

November 28, 2023

Stuart Casciano
Mandell Environmental Consulting
409 Minnisink Road
Suite 102
Totowa, NJ 07512

RE: Project: THE LEAGUERS 11/9
Pace Project No.: 70278353

Dear Stuart Casciano:

Enclosed are the analytical results for sample(s) received by the laboratory on November 20, 2023. The results relate only to the samples included in this report. Results reported herein conform to the applicable TNI/NELAC Standards and the laboratory's Quality Manual, where applicable, unless otherwise noted in the body of the report.

The test results provided in this final report were generated by each of the following laboratories within the Pace Network:
• Pace Analytical Services - Melville

If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in cursive script that reads "Kimberley Mack".

Kimberley M. Mack
kimberley.mack@pacelabs.com
516-370-6052
Project Manager

Enclosures



REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

CERTIFICATIONS

Project: THE LEAGUERS 11/9
Pace Project No.: 70278353

Pace Analytical Services Long Island

575 Broad Hollow Rd, Melville, NY 11747

Connecticut Certification #: PH-0435

Delaware Certification # NY 10478

Maryland Certification #: 208

Massachusetts Certification #: M-NY026

New Hampshire Certification #: 2987

New Jersey Certification #: NY158

New York Certification #: 10478 Primary Accrediting Body

Pennsylvania Certification #: 68-00350

Rhode Island Certification #: LAO00340

Virginia Certification # 460302

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

ANALYTICAL RESULTS

Project: THE LEAGUERS 11/9

Pace Project No.: 70278353

Sample: 1111-1A		Lab ID: 70278353001		Collected: 11/09/23 11:00		Received: 11/20/23 15:30		Matrix: Drinking Water	
Parameters		Results	Units	Report Limit	DF	Prepared	Analyzed	CAS No.	Qual
200.8 MET ICPMS Drinking Water		Analytical Method: EPA 200.8 Pace Analytical Services - Melville							
Copper	35.9	ug/L	2.0	1		11/27/23 15:31	7440-50-8		
Lead	<1.0	ug/L	1.0	1		11/27/23 15:31	7439-92-1		

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.

Date: 11/28/2023 01:03 PM

Page 3 of 9



QUALITY CONTROL DATA

Project: THE LEAGUERS 11/9
Pace Project No.: 70278353

QC Batch: 328784 Analysis Method: EPA 200.8
QC Batch Method: EPA 200.8 Analysis Description: 200.8 MET No Prep Drinking Water
Laboratory: Pace Analytical Services - Melville

Associated Lab Samples: 70278353001

METHOD BLANK: 1682422 Matrix: Water

Associated Lab Samples: 70278353001

Parameter	Units	Blank Result	Reporting Limit	Analyzed	Qualifiers
Copper	ug/L	<2.0	2.0	11/27/23 14:50	
Lead	ug/L	<1.0	1.0	11/27/23 14:50	

LABORATORY CONTROL SAMPLE: 1682423

Parameter	Units	Spike Conc.	LCS Result	LCS % Rec	% Rec Limits	Qualifiers
Copper	ug/L	50	46.3	93	85-115	
Lead	ug/L	50	48.0	96	85-115	

MATRIX SPIKE SAMPLE: 1682425

Parameter	Units	70278345007 Result	Spike Conc.	MS Result	MS % Rec	% Rec Limits	Qualifiers
Copper	ug/L	5.5	50	48.6	86	70-130	
Lead	ug/L	<1.0	50	45.9	92	70-130	

MATRIX SPIKE SAMPLE: 1682427

Parameter	Units	70278345008 Result	Spike Conc.	MS Result	MS % Rec	% Rec Limits	Qualifiers
Copper	ug/L	<2.0	50	47.1	94	70-130	
Lead	ug/L	<1.0	50	47.7	95	70-130	

SAMPLE DUPLICATE: 1682424

Parameter	Units	70278345007 Result	Dup Result	RPD	Qualifiers
Copper	ug/L	5.5	5.5	0	
Lead	ug/L	<1.0	<1.0		

SAMPLE DUPLICATE: 1682426

Parameter	Units	70278345008 Result	Dup Result	RPD	Qualifiers
Copper	ug/L	<2.0	<2.0		
Lead	ug/L	<1.0	<1.0		

Results presented on this page are in the units indicated by the "Units" column except where an alternate unit is presented to the right of the result.

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.



QUALIFIERS

Project: THE LEAGUERS 11/9
Pace Project No.: 70278353

DEFINITIONS

DF - Dilution Factor, if reported, represents the factor applied to the reported data due to dilution of the sample aliquot.

ND - Not Detected at or above adjusted reporting limit.

TNTC - Too Numerous To Count

J - Estimated concentration above the adjusted method detection limit and below the adjusted reporting limit.

MDL - Adjusted Method Detection Limit.

PQL - Practical Quantitation Limit.

RL - Reporting Limit - The lowest concentration value that meets project requirements for quantitative data with known precision and bias for a specific analyte in a specific matrix.

S - Surrogate

1,2-Diphenylhydrazine decomposes to and cannot be separated from Azobenzene using Method 8270. The result for each analyte is a combined concentration.

Consistent with EPA guidelines, unrounded data are displayed and have been used to calculate % recovery and RPD values.

LCS(D) - Laboratory Control Sample (Duplicate)

MS(D) - Matrix Spike (Duplicate)

DUP - Sample Duplicate

RPD - Relative Percent Difference

NC - Not Calculable.

SG - Silica Gel - Clean-Up

U - Indicates the compound was analyzed for, but not detected.

N-Nitrosodiphenylamine decomposes and cannot be separated from Diphenylamine using Method 8270. The result reported for each analyte is a combined concentration.

Reported results are not rounded until the final step prior to reporting. Therefore, calculated parameters that are typically reported as "Total" may vary slightly from the sum of the reported component parameters.

Pace Analytical is TNI accredited. Contact your Pace PM for the current list of accredited analytes.

TNI - The NELAC Institute.

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.



Pace Analytical Services, LLC
575 Broad Hollow Road
Melville, NY 11747
516-370-6000

QUALITY CONTROL DATA CROSS REFERENCE TABLE

Project: THE LEAGUERS 11/9
Pace Project No.: 70278353

Lab ID	Sample ID	QC Batch Method	QC Batch	Analytical Method	Analytical Batch
70278353001	1111-1A	EPA 200.8	328784		

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
without the written consent of Pace Analytical Services, LLC.

WO#: 70278353



70278353

CHAIN-OF-CUSTODY / Analytical Request Document

The Chain-of-Custody is a LEGAL DOCUMENT. All relevant fields must be completed accurately.

Section A Required Client Information				Section B Required Project Information				Section C Invoice Information			
Company	Address	City	State	Report To:	Copy To:	Project Name:	Project Number:	Client Name:	Address:	City:	State:
OSWALDO & ASSOCIATES	200 MINNISKIE BLVD	ST. LOUIS, MO	63101	OSWALDO & ASSOCIATES	OSWALDO & ASSOCIATES	THE LEAGUES	10278353	OSWALDO & ASSOCIATES	200 MINNISKIE BLVD	ST. LOUIS, MO	63101
Section D Required Client Information Matrix Codes: Drinking Water, WWT, Wastewater, Industrial, Solid, Oil, Sludge, Air, Tissue, Other SAMPLE ID: 1111-1A Sample IDs MUST BE UNIQUE				Section E Required Project Information Matrix Code: DW Sample Type: (G-GRAB C-COMP) Matrix Code: (see valid codes to fill)				Section F Invoice Information Invoice Number: 2054209 Date: 11/23/23			
Section G Required Project Information Project Name: THE LEAGUES Project Number: 10278353 Requested Due Date: 11/23/23				Section H Required Project Information Project Name: THE LEAGUES Project Number: 10278353 Requested Due Date: 11/23/23				Section I Required Project Information Project Name: THE LEAGUES Project Number: 10278353 Requested Due Date: 11/23/23			
Section J Required Project Information Project Name: THE LEAGUES Project Number: 10278353 Requested Due Date: 11/23/23				Section K Required Project Information Project Name: THE LEAGUES Project Number: 10278353 Requested Due Date: 11/23/23				Section L Required Project Information Project Name: THE LEAGUES Project Number: 10278353 Requested Due Date: 11/23/23			

ORIGINAL

SAMPLER NAME AND SIGNATURE

PRINT NAME of SAMPLER: Darren Slack

SIGNATURE of SAMPLER: [Signature]

SAMPLER NAME AND SIGNATURE

PRINT NAME of SAMPLER: Darren Slack

SIGNATURE of SAMPLER: [Signature]

DATE SIGNED: 11-9-23

Temp in °C
Received on (Y/N)
Custody (Y/N)
Field Cooler (Y/N)
Plates intact (Y/N)

ADDITIONAL COMMENTS

RELINQUISHED BY / AFFILIATION

DATE

TIME

ACCEPTED BY / AFFILIATION

DATE

TIME

SAMPLE CONDITIONS

Residual Chlorine (Y/N)

Pace Project No./ Lab I.D.

Client: **MEC**

Profile #: **5901**

☐ Use Point Number Spreadsheet

☐ Multiday Project

Work ID: **the Leagues 11/9**

COC Page _____ of _____

☐ Add SCLOGFD to first sample for field charge

COC	LOC	Site	Matrix	Container	Material	Volume	Notes
1							
2							
3							
4							
5							
6							
7							
8							
9							
10							
11							
12							

Container Counts

Container	Material	Volume	Notes
VG8U	40mL undres clear vial	AG4U	125mL undres amber glass
VG8C	40mL Ascorbic-HCl clear vial	AG3U	125mL undres amber glass
VG8H	40mL HCl clear vial	AG2U	125mL undres amber glass
VG8S	40mL Sulfuric clear vial	AG1U	125mL undres amber glass
DG8T	40mL Na Thiosulfate vial	AG34	125mL undres amber glass
DG8Y	40mL Citrate-Na Thiosulfate	AG3S	125mL undres amber glass
DG8P	40mL undres vial - TSP	AG4E	125mL undres amber glass
DG8A	Ascorbic-Maleic Acid 40mL	AG3T	125mL undres amber glass
DG8T	Na Thio 60mL Vial	AG2R	125mL undres amber glass
DG8S	Ammonium CWCUSO4 40mL	AG1T	125mL undres amber glass
CG1U	1L Unpres Jar (Can Ed)	AG1H	1L HCl amber glass
WG8O	3oz clear soil jar	AG1A	(NH4Cl)
WG4O	4oz clear soil jar		

Container	Material	Volume	Notes
BP1U	1L Unreserved plastic	SP5T	120mL Corform Na Thio
BP3U	250mL HNO3 plastic	R	Terracore Kit
BP3C	250mL Sodium Hydroxide	WG5U	2oz Unreserved Jar
AG3U	500mL undres amber glass	WG5U	4oz Unreserved Jar
		WG5U	8oz Unreserved Jar
		WG5U	16oz Unreserved Jar

* Can also be a BPA

Container	Material	Volume	Notes
WT	Water		
SL	Solid		
NAL	Non-aqueous Liquid		
OL	Oil		
WP	Wipe		
DW	Drinking Water		

Container	Material	Volume	Notes
VG8T	40mL Na Thio amber vial		
DG8A	40mL Ascorbic acid-maleic acid vial		
DG8Y	Citrate-Na Thiosulfate 40mL		
DG8T	Na Thiosulfate 60mL vial		
DG8S	Ammonium CWCUSO4 40mL		
AG3U	250mL undres amber glass		
AG3T	Na Thiosulfate 250mL bottle		
BP1B	Na Thiosulfate Amber bottle		
AG1T	Na Thiosulfate 1L Amber		
AG1A	625.3 Chemical Blend		

Sender Initials

Additional Comments

WO#: 70278353

PM: KMM Due Date: 11/30/23

CLIENT: MEC

Effective Date: 10/13/2023

WO#: 70278353

Client Name: MEC

Project:

PM: KMM

Due Date: 11/30/23

Courier: ☐ Fed Ex ☐ UPS ☐ USPS ☐ Client ☐ Commercial ☒ Pac ☐ Other

CLIENT: MEC

Tracking #:

Custody Seal on Cooler/Box Present: ☐ Yes ☒ No Seals intact: ☐ Yes ☒ No Temperature Blank Present: ☐ Yes ☒ NoPacking Material: ☐ Bubble Wrap ☐ Bubble Bags ☐ Ziplo ☒ Non ☐ Other Type of Ice: ☒ Wet ☐ Blue ☐ NoneThermometer Used: THU1 Correction Factor: 0.3 ☐ Samples on ice, cooling process has begunCooler Temperature (°C): 2.6 Cooler Temperature Corrected (°C): 2.9 Date/Time 5035A kits placed in freezer

Temp should be above freezing to 6.0°C

USDA Regulated Soil ☒ N/A, water sampleDid samples originate in a quarantine zone within the United States: AL, AR, CA, FL, GA, ID, LA, MS, NC, NM, NY, OK, OR, SC, TN, TX, or VA (check map)? ☐ Yes ☒ NoDid samples originate from a foreign source including Hawaii and Puerto Rico? ☐ Yes ☒ No

If Yes to either question, fill out a Regulated Soil Checklist (ENV-FRM-MELV-0076) and include with SCUR/COC paperwork.

Date and Initials of person examining contents: MPL 11/21

		COMMENTS:
Chain of Custody Present:	☒ Yes ☐ No	1.
Chain of Custody Filled Out:	☒ Yes ☐ No	2.
Chain of Custody Relinquished:	☒ Yes ☐ No	3.
Sampler Name & Signature on COC:	☒ Yes ☐ No ☐ N/A	4.
Samples Arrived within Hold Time:	☒ Yes ☐ No	5.
Short Hold Time Analysis (<72hr):	☐ Yes ☒ No	6.
Rush Turn Around Time Requested	☐ Yes ☒ No	7.
Sufficient Volume: (Triple volume provided for MS/MSD)	☒ Yes ☐ No	8.
Correct Containers Used:	☒ Yes ☐ No	9.
-Pace Containers Used:	☒ Yes ☐ No	10.
Containers Intact:	☒ Yes ☐ No	11.
Filtered volume received for Dissolved tests	☐ Yes ☒ No ☐ N/A	Note: if sediment is visible in the dissolved container.
Sample Labels match COC:	☒ Yes ☐ No	12.
-Includes date/time/ID/Analysis Matrix:	SL WT OIL OTHER	

Date and Initials of person checking preservation: MPL 11/21

All containers needing preservation have been	☒ Yes ☐ No ☐ N/A	13.	☐ HNO ₃ ☐ H ₂ SO ₄ ☐ NaOH ☐ HCl
pH paper Lot # <u>227822V</u>		Sample #	
All containers needing preservation are found to be in compliance with method recommendation?			
(HNO ₃ , H ₂ SO ₄ , HCl, NaOH > 9 Sulfide)	☒ Yes ☐ No ☐ N/A		
NAOH > 12 Cyanide			
Exceptions: VOA, Coliform, TOC/DOC, Oil and Grease, DRO/8015 (water).			
Per Method, VOA pH is checked after analysis		Initial when completed:	Lot # of added preservative:
Samples checked for dechlorination:	☐ Yes ☐ No ☐ N/A		Date/Time preservative added:
KI starch test strips Lot #		14.	
Residual chlorine strips Lot #		Positive for Res. Chlorine?	Y N
SM 4500 CN samples checked for sul	☐ Yes ☐ No ☐ N/A	15.	
Lead Acetate Strips Lot #		Positive for Sulfide?	Y N
Headspace in VOA Vials (>6mm):	☐ Yes ☐ No ☐ N/A	16.	
Trip Blank Present:	☐ Yes ☐ No ☐ N/A	17.	
Trip Blank Custody Seals Present	☐ Yes ☐ No ☐ N/A		

DATE AND INITIALS OF PERSON COMPLETING SECOND REVIEW: MPL 11/21/23

Client Notification/ Resolution:

Field Data Required?

Y / N

Person Contacted:

Date/Time:

Comments/ Resolution:

* PM (Project Manager) review is documented electronically in LIMS.

Attachment C - Drinking Water Outlet Inventory (Complete for each school)

Name of School: THE LEAGUES HEADS START Address: 1111 CHANDLER AVE, ROSELLE NJ
CHILD CARE

Grade Levels: _____ Year School Constructed: _____ Renovated/Additions: _____

Individual school project officer Name/Signature: _____

Date Completed: _____

#	Type	Location	Code	Operational ¹ (Y/N)	Signs of Corrosion ² (Y/N)	Filter ³ (Y/N)	Brass Fittings, Faucets or valves ⁴ (Y/N)	Aerator/ Screen (Y/N)	Motion Activated (Y/N)	Chiller (Y/N)	Water Cooler Make Model	Co
1	TWF	MENS ROOM		YES	NO	N		N	N	N/A	N/A	
2		" "										
3		WOMENS ROOM										
4		" "										
5		GIRLS ROOM										
6		" "										
7		" "										
8		" "										
9		JAN. CLOSET										
10		BOYS ROOM										
11	✓	" "										

TWF INDOOR WATER FOUNTAIN W/F- WATER FOUNTAIN
 WC- WATER COOLER

- ¹ Number outlets starting at the closest outlet to the Point of Entry (POE).
- ² Document if permanently or temporarily out of service on the Attachment B- Plumbing Profile.
- ³ Signs of corrosion detected, such as but not limited to frequent leaks, rust-colored water, or stained fixtures, dishes, or laundry.
- ⁴ Document on Attachment D- Filter Inventory.

Attachment C - Drinking Water Outlet Inventory

(Complete for each school)

Name of School: THE LEAGUES Head STADI Address: 111 CHANDLER AVE, ROSALL- NJ

CHILD CARD

Grade Levels: _____ Year School Constructed: _____ Renovated/Additions: _____

Individual school project officer Name/Signature: _____

Date Completed:

#	Type	Location	Code	Operational ¹ (Y/N)	Signs of Corrosion ² (Y/N)	Filter ³ (Y/N)	Brass Fittings, Flanges, or Valves? (Y/N)	Aerator/ Screen (Y/N)	Motion Activated (Y/N)	Chiller (Y/N)	Water Cooler: Make _____ Model _____	Col
12	TWF	Boys Room		Y	N	N	N	N	N	N		
13	"	"										
14	Food Prep	KITCHEN										
15	TWF	"		Y								
WC1	WC	OFFICE										
WC2	"	HALLWAY									EKAY EAFS8 1B	
WC3	"	KITCHEN		NO							"	
WC7	W/F	HALLWAY		NO							APRUE D3G700 K	

¹ Number outlets starting at the closest outlet to the Point of Entry (POE).

² Document if permanently or temporarily out of service on the Attachment B- Plumbing Profile.

³ Signs of corrosion detected, such as but not limited to frequent leaks, rust-colored water, or stained fixtures, dishes, or laundry.

⁴ Document on Attachment D- Filter Inventory.

Attachment D - Filter Inventory
(Complete for each school)


Name of School: The Cragwells Head School Grade Levels: _____

Address: 1111 CHANDLER AVE, ROSELLE NJ

Individual School Project Officer Signature: _____ Date: _____

[illegible]

2022-23

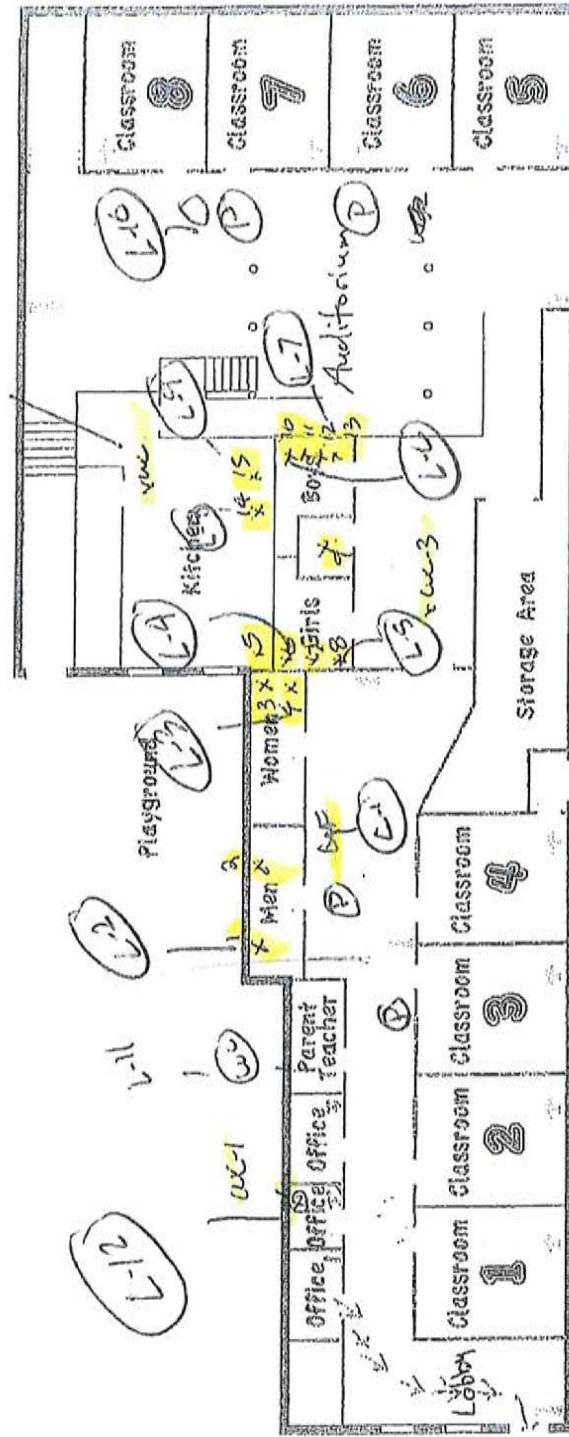

Newman Pl.

LEGEND:  First Aid Kits

في الميادين

Excluding Rouse